


接线图 Wiring diagram:

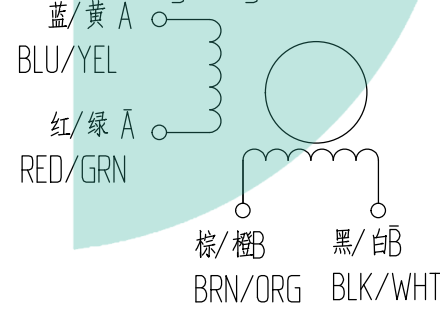

励磁顺序(2相励磁)

Exciting Sequence(Two Phase)

STEP	A	B	\bar{A}	\bar{B}
1	+	+	-	-
2	-	+	+	-
3	+	+	-	-
4	+	-	-	+

Direction of rotation: CW (Clockwise) and CCW (Counter-clockwise) are indicated by arrows.

技术参数 Electrical specifications:

相数	Phase	2
步距角(°)	Step Angle	1.8±5%
相电流(A)	Current	4.2
相电阻(Ω)	Resistance	0.55±10%
相电感(mH)	Inductance	1.8±20%
静力矩(N.m)	Holding Torque	2.2
转子惯量(g.cm ²)	Rotor Inertia	500
定位力矩(N.cm)	Detent Torque	6
绝缘等级	Insulation Class	B级
绝缘电阻	Insulation resistance	100MΩmin.500VDC

CNC PARTS