


接线图 Wiring diagram

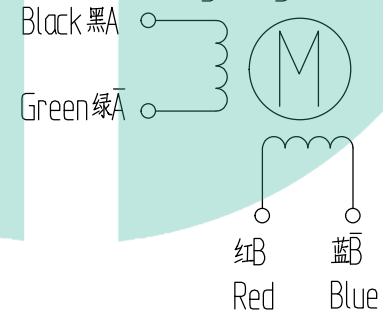

励磁顺序(2相励磁)

Exciting Sequence(Two Phase)

STEP	A	B	\bar{A}	\bar{B}
1	+	+	-	-
2	-	+	+	-
3	+	+	-	-
4	+	-	-	+



技术参数 Electrical specifications:

相数	Phase	2
步距角(°)	Step Angle	1.8±5%
相电流(A)	Current	1.5
相电阻(Ω)	Resistance	3±10%
相电感(mH)	Inductance	6.9±20%
静力矩(N.m)	Holding Torque	0.6
转子惯量(g.cm ²)	Rotor Inertia	110
定位力矩(N.cm)	Detent Torque	3.5
绝缘等级	Insulation Class	B级
绝缘电阻	Insulation resistance	100MΩmin.500VDC

42HS06

10050216